

Attic

Inventory Condition and Assessment Program

Interior

Elevation:

Room #: R301

Room Name / Use: Attic (1751 section)

Date of Assessment:

Photo Nos.:


[66. Attic over ca. 1751 section, east gable;](#)

[67. Attic over ca. 1751 section, east and south;](#)

[68. Attic over ca. 1751 section, west wall, chimney mass;](#)

[69. Attic over R 204, frame infill section.](#)

Peter Burr House

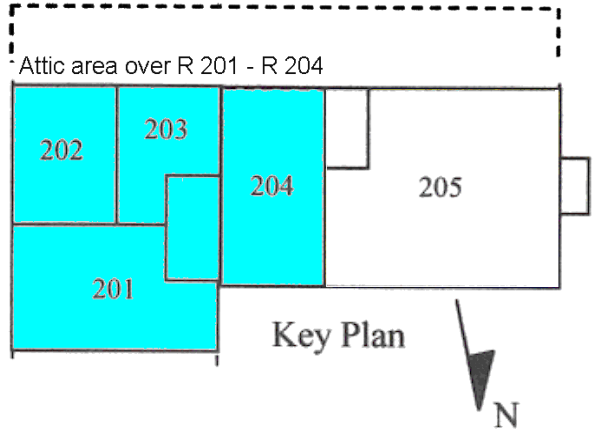

Attic over ca. 1751 Section,
East Gable



Attic over ca. 1751 Section,
East and South



Attic over ca. 1751 Section,
West Wall, Chimney Mass



Attic over R204, Frame Infill
Section



| Feature Description | Condition |
|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------|
| Flooring | |
| Northeast white pine tongue and grooved surface nailed flooring, random width was the original flooring of the stair closet. | No flooring except for two broken pieces remains in situ. |
| Walls | |
| The east and south walls were the he log and daubed walls of the log crib. Whitewash still heavily coats the walls. | While some daubing is missing, the log walls appear to be in salvageable condition. |
| The north wall consisted of the whitewashed treads and risers. The west wall was made of vertical boards, tongue, grooved and 1/4" beaded to show into the kitchen. The boards facing the closet were hand-planned and whitewashed. | The risers and treads as well as the w wall appear to be in good condition. |
| Ceiling | |
| The ceiling of the stair storage area was the back sides of the risers and the bottoms of the treads. All were originally whitewashed. | |
| Trim | |
| There was a plain board narrow trim nailed to the vertical board wall around the door opening to act as a doorstop. | All |
| Original Configuration | |
| The closet retains its original configuration. | . |
| Alterations | |
| There were no alterations. | |